


Description	Suitable for measurement of positive pressure, vacuum or differential pressure.		
Media	compressed air or non-corrosive gases		
Supply voltage	15...30 V DC standard, optionally 230 V AC $\pm 10\%$		
Electrical connector	plug with 7-pin screw terminal for cable cross-sectional area 0.14...1.5 mm ²		
Pneumatic connection	P+ : pos. pressure P- : vacuum P+/P- : differential pressure, the higher pressure is to be connected at P+ plug nipple up to 1 bar, sleeve with union nut from 2 bar on, each for hose internal diameter of $\varnothing 4$ mm		
Display	3½-digit LCD display, max. ± 1999 , 14 mm tall, black numbers		
Output signal	0...10 V, impedance > 10 k Ω , optionally 4...20 mA, impedance < 500 Ω		
Linearity	see chart, optionally 0.2% FS		
Long-term stability	< 0.1% FS per year at > 25 mbar, < 1% FS per year at > 5 mbar, < 2% FS per year at < 5 mbar range		
Temperature sensitivity	see chart, at 0 °C to 50 °C / 32 °F to 122 °F		
Response time	100 ms		
Temperature range	-20 °C to 50 °C / -4 °F to 122 °F		
Material	Housing: aluminium		
	Overpressure	see chart	
	Hysteresis	< 0.1% FS	
	Repeatability	see chart	
	Resolution	1 digit	
	Protection class	IP 54	

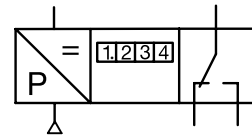

0...1 mbar / 1000 bar
pressure, vacuum, differential pressure


Repeatability	Temperature error	Linearity error	Over-pressure	Measurement range	Order number
% FS	% FS	% FS	max. bar	mbar/bar	

Digital gauge	for compressed air, measurement of positive pressure, vacuum and differential pressure, 24 V DC, outlet signal 0...10 V, 3½-digit display				MKA
1.0	4.0	1.0	0.25	0... 1 mbar	MKA-A1
0.3	2.5	0.8	0.25	0... 2.5 mbar	MKA-A2
0.3	1.2	0.8	0.25	0... 5 mbar	MKA-A5
0.2	1.0	0.8	0.25	0... 10 mbar	MKA-B1
0.1	1.0	0.7	0.35	0... 20 mbar	MKA-B2
0.1	1.0	0.7	0.35	0... 50 mbar	MKA-B5
0.1	1.0	0.5	0.35	0... 100 mbar	MKA-C1
0.1	1.0	0.5	0.75	0... 200 mbar	MKA-C2
0.1	1.0	0.5	1.5	0... 500 mbar	MKA-C5
0.1	1.0	0.5	3.0	-1... 1 bar	MKA-V1
0.1	1.0	0.5	3.0	0... 1 bar	MKA-01
0.1	1.0	0.5	4.0	0... 2 bar	MKA-02
0.1	2.0	0.5	10	0... 8 bar	MKA-08
0.1	2.0	0.5	12	0... 10 bar	MKA-10
0.1	2.3 mbar	1 mbar	3.3	0.7... 1.1 bar _{abs}	MKA-S1

Digital gauge for external sensor	0...10 V input signal, supply voltage 24 V DC, 3½-digit display				MKA*2
96	48	137	e.g. for pressure transducer		MKA-00


Special options, add the appropriate letter

two limit switches	with LED display, 230 V AC, 1 A, hysteresis 2% FS	MKA-...S
linearity < 0.2% FS	from 100 mbar	MKA-...B
4...20 mA output signal	impedance < 500 Ω	MKA-...A
4...20 mA input signal	internal resistance 100 Ω	MKA-00A
P _a indication	< 20 mbar: indication P _a > 20 mbar: indication kPa	MKA-...P
230 V AC	supply voltage	MKA-...V
RS232*1	interface, 8 bit without parity	MKA-...R
deviant measurement range	to be indicated on order	MKA-XX

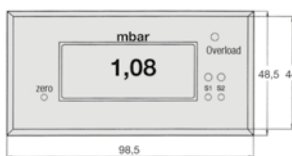


panel cut-out 45 x 93 mm

front view

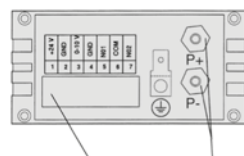

multiple pin strip pressure connectors

back view

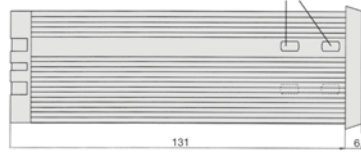

side view

*1 Handshake on/off, Baudrate 9600

*2 indicate pressure range by order

Calibration or test chart: see chapter "Technical Information"
Pressure transducers: see chapter "Pressure Transducers"


PDF CAD
www.aircom.net




MKA, with integrated pressure transducer




MKA-00, with external pressure transducer

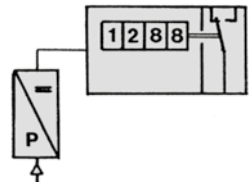

MKA-00, with external pressure transducer

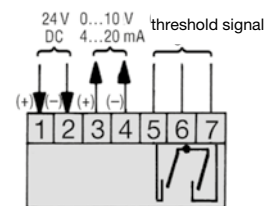

electrical connection

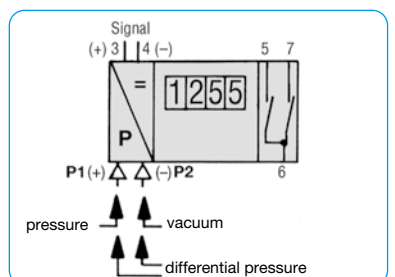

pneumatical connection

* Product group

Order example:
MKA-A1